



#### **SERIES E40 NON SLIP**



Eurobelt Series E40 Non Slip has a closed surface with a relief specially designed to avoid slips. Both its high resistance to traction and to chemical aggression of oils and industrial acids make it be the suitable belt for assembly lines in the car industry, for conveying people, furniture, electrical appliances, etc.

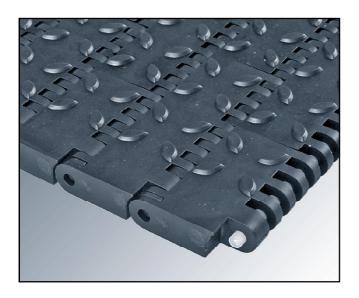

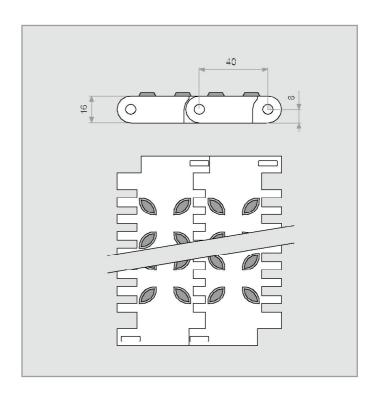

Pitch	40 mm
Surface	Non Slip
Open area	0 %
Thickness	16 mm
Drive system	Central
Belt width	Multiples of 10 mm
Rod diameter	Ø 6 mm
Retention system	Сар

Material of the belt	Material of the rod	Belt strength (kg/m)	Temperature range (°C)	Belt weight (kg/m²)	Available colours in stock
PPE - Electrically Conductive Polypropylene (1)	DD D-1	3,600	+1 to +104	11.97	[0]
ACE - Electrically Conductive Polyacetal (1)	PP - Polypropylene	Ask for availal		availability	


This conveyor belt is manufactured in conductive materials to disperse the electrostatic charges through the conveyor frame.


Colours: [W] White - [G] Grey - [B] Blue - [N] Natural - [O] Black. // The materials and colours that are normally in stock are those above indicated. In special cases in which it is needed a belt in a material or colour different from those above mentioned, you should ask directly to EUROBELT.

<sup>(1)</sup> Unsuitable for direct contact with food.




# ACCESSORIES [SPROCKETS]

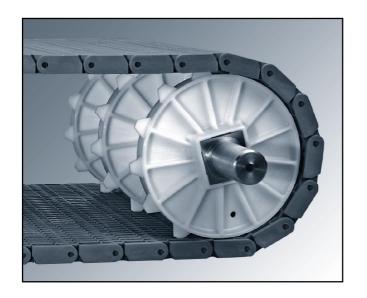

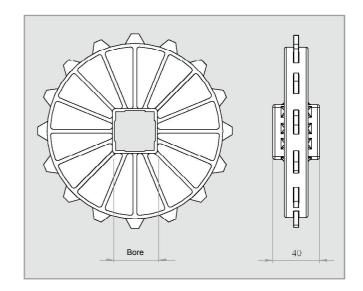

N° of teeth	Pitch Bore for square shaft Hub		Pitch	Bore for square shaft		Matariala
Т	diameter	mm	inch	width	Materials	
8	104.5	40	1.5"	40		
10	129.4	40 60	1.5"	40		
13	167.1	40 60	1.5"	40	Polypropylene Polyacetal	
16	205	40 60	1.5"	40	Stainless steel	
20	255.7	40 60 90	1.5"	40		

## DOUBLE-TOOTHED SPROCKET

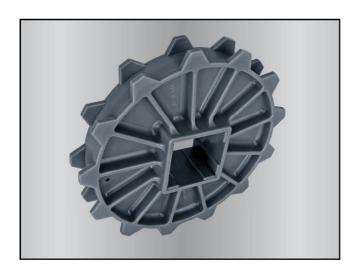


N° of teeth T	13
Ø Pitch	167.1
Bore for square shaft (mm)	40 60
Bore for square shaft (inch)	1.5" 2.5"
Hub width	40
Materials	Polypropylene Polyacetal



## ACCESSORIES [[SPROCKETS AND RETAINING RINGS]

#### SPROCKETS FOR SQUARE SHAFT

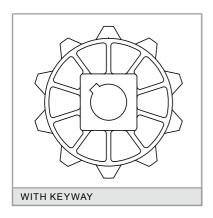



We have plastic sprockets for round shaft with and without keyway. We also have sprockets to be used with motor drum in applications needing a special cleaning or in conveyors in which it is not possible to place the motor in the outside due to problems of space or safety.

#### INSTALLATION


These rings are placed at every side of the central sprocket to fasten it to the shaft in order to avoid any lateral movements of the belt.


They are manufactured in AISI 316 stainless steel and they are fixed by means of a set screw stuffed in the ring itself.

One sprocket, duly fixed with 2 retaining rings, should be put in the centre. Then you should place the same quantity of sprockets at every side of the central one but without any fixing, as they will absorb the possible belt expansions and contractions.

The same procedure should be carried out in both shafts.


Screws
M 6 x 6
M 6 x 6
M 6 x 6

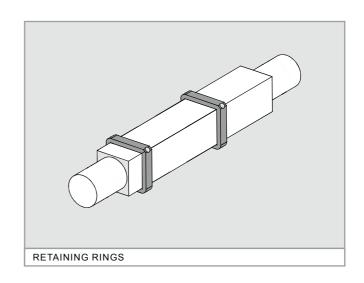


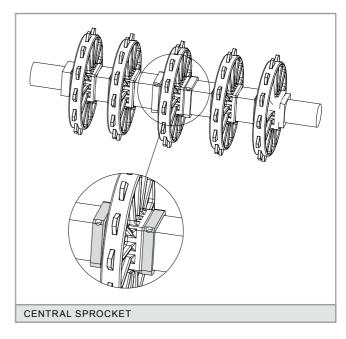



## **CONSTRUCTION DATA [CONVEYOR]**

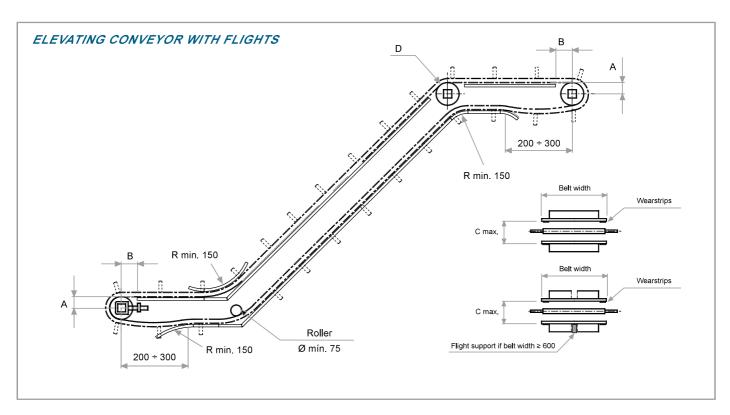

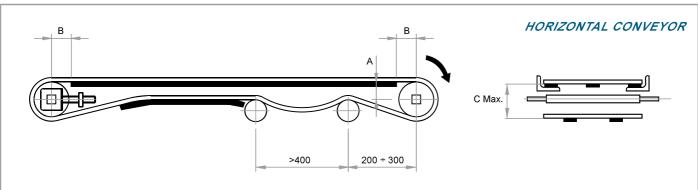

- [A] Distance between the sliding surface of the belt and the centre of the shaft.
- **[B]** Distance between the vertical of the shaft and the beginning of the sliding surface.
- **[C]** Distance between the sliding surface of the belt and the support of the return way.
- [D] If sprockets are used in the inflexion shaft, do not retain the central one.
- [R] This radius must be as big as allowed by the application in order to minimize the wear (min. 150 mm). For belts with side guards, consult about this radius.

In the construction of conveyors, the distances appearing in the chart below must be respected according to the belt Series and the size of the sprockets.

N° of teeth T	Ø Pitch	А	B max.	C max.
8	104.5	43	45	105
10	129.4	56	55	130
13	167.1	75	70	165
13D	167.1	75	70	165
16	205	94	80	205
20	255.7	120	90	255



### TABLE OF SPROCKETS AND WEARSTRIPS

Belt nominal width (mm)		Minimum quantity	Minimum quantity of wearstrips		
wiath	(mm)	of sprockets per shaft	Transport way	Return way	
60	150	1	2	2	
160	450	3	2	2	
460	750	5	3	2	
760	1,050	7	5	3	
1,060	1,350	9	6	4	
1,360	1,650	11	7	5	
1,660	1,950	13	9	6	
1,960	2,250	15	10	7	
2,260	2,550	17	11	8	
2,560	2,850	19	12	9	
2,860	3,150	21	14	10	
3,160	3,450	23	15	11	
3,460	3,750	25	16	12	
3,760	4,050	27	18	13	

To calculate the necessary minimum quantity of sprockets for the drive shaft as well as for the idle one, the next formula has been used:

This amount must always be odd.

To calculate the quantity of supports, the weight of the product to be transported must be taken into account.

The distance between supports should not exceed 230 mm in the transport way or 300 mm in the return way.

